

PolyMaker™ PC-ABS

PolyMaker™ PC-ABS is a PC/ABS alloy based filament designed specifically for FDM/FFF 3D printing. It offers great low temperature impact and superior printing quality

Physical Properties

Property	Testing method	Typical value
Density	ASTM D792 (ISO 1183, GB/T 1033)	1.1 (g/cm ³ at 21.5°C)
Melt index	260 °C, 5 kg	11-17 (g/10 min)
Vicat Softening temperature	ASTM D1525 (ISO 306 GB/T 1633)	135 (°C)
Glass transition temperature	DSC, 10 °C/min	109 (°C)

Tested with 3D printed specimen of 100% infill

Mechanical Properties

Property	Testing method	Typical value
Young's modulus (X-Y)	ASTM D638 (ISO 527, GB/T 1040)	1832 ± 65 (MPa)
Tensile strength (X-Y)	ASTM D638 (ISO 527, GB/T 1040)	39.9 ± 1.0 (MPa)
Elongation at break (X-Y)	ASTM D638 (ISO 527, GB/T 1040)	4.2 ± 0.3 (%)
Bending modulus (X-Y)	ASTMD790 (ISO 178, GB/T 9341)	2081 ± 106 (MPa)
Bending strength (X-Y)	ASTMD790 (ISO 178, GB/T 9341)	66.3 ± 1.3 (MPa)
Charpy impact strength (X-Y)	ASTM D256 (ISO 179, GB/T 1043)	25.8 ± 1.4 (kJ/m ²)
Young's modulus (Z)	ASTM D638 (ISO 527, GB/T 1040)	2297 ± 113 (MPa)
Tensile strength (Z)	ASTM D638 (ISO 527, GB/T 1040)	40 ± 2.2 (MPa)
Elongation at break (Z)	ASTM D638 (ISO 527, GB/T 1040)	3.3 ± 0.9 (%)
Charpy impact strength (Z)	ASTM D256 (ISO 179, GB/T 1043)	3.5 ± 0.2(kJ/m ²)

All testing specimens were printed under the following conditions:

nozzle temperature = 260 °C, printing speed = 60 mm/s, build plate temperature = 110 °C, infill = 100%, Chamber temperature = 80 °C


All specimens were conditioned at room temperature for 24h prior to testing

Recommended printing conditions



Parameter	
Nozzle temperature	250-270 (°C)
Build Surface material	BuildTak®
Build plate temperature	90-110 (°C)
Cooling fan	Turned off
Printing speed	40-60 (mm/s)
Raft separation distance	0.2 (mm)
Retraction distance	1-3 (mm)
Retraction speed	60 (mm/s)
Recommended environmental temperature	80 (°C)
Threshold overhang angle	45 (°)
Recommended support material	PolyDissolve S2

Based on 0.4 mm nozzle and Simplify 3D v.4.0. Printing conditions may vary with different nozzle diameters



- For better part strength and to relieve the residual stress, annealing the parts at 90°C for 1 hour right after printing
- PolyMaker™ PC-ABS needs be dried before printed, if it has been stored in air for long time

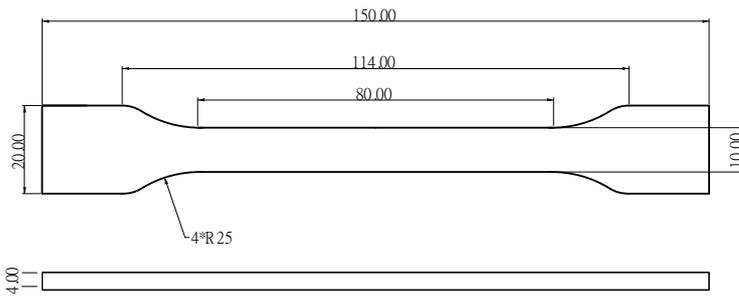


Tensile testing specimen; ASTM D638 (ISO 527, GB/T 1040)

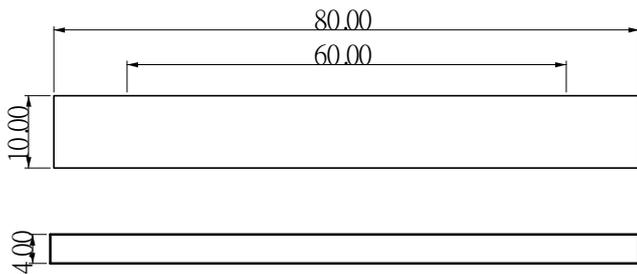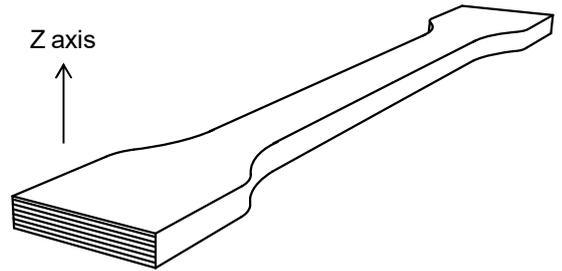

Flexural testing specimen; ASTM D790 (ISO 178, GB/T 9341)

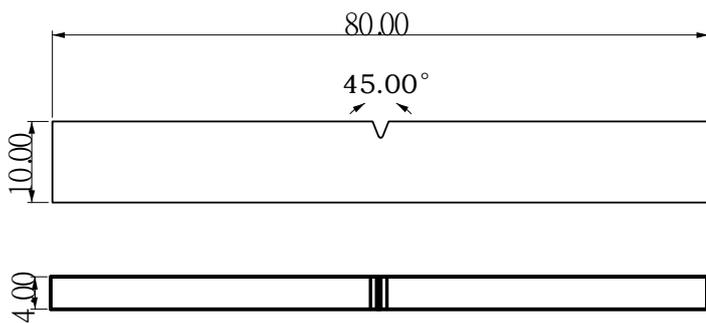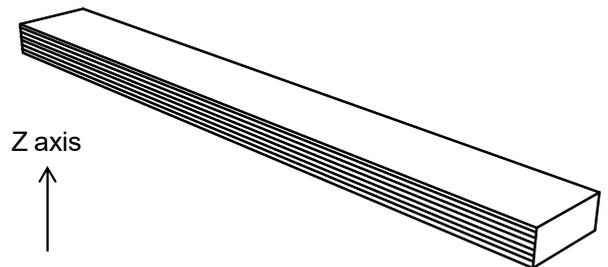

Impact testing specimen; ASTM D256 (ISO 179, GB/T 1043)

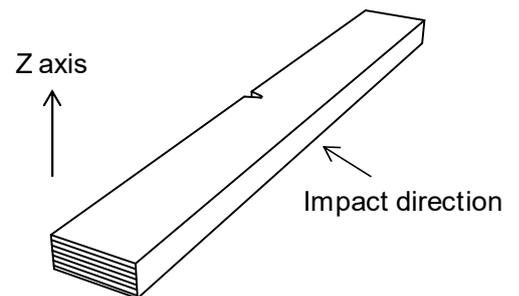

Disclaimer:

The typical values presented in this data sheet are intended for reference and comparison purposes only. They should not be used for design specifications or quality control purposes. Actual values may vary significantly with printing conditions. End- use performance of printed parts depends not only on materials, but also on part design, environmental conditions, printing conditions, etc. Product specifications are subject to change without notice.

Each user is responsible for determining the safety, lawfulness, technical suitability, and disposal/recycling practices of Polymaker materials for the intended application. Polymaker makes no warranty of any kind, unless announced separately, to the fitness for any use or application. Polymaker shall not be made liable for any damage, injury or loss induced from the use of Polymaker materials in any application.